V1.3


MANUAL



JME3


Automatic 3D Scanner-Ear

P1 HARDWARE CONNECTION

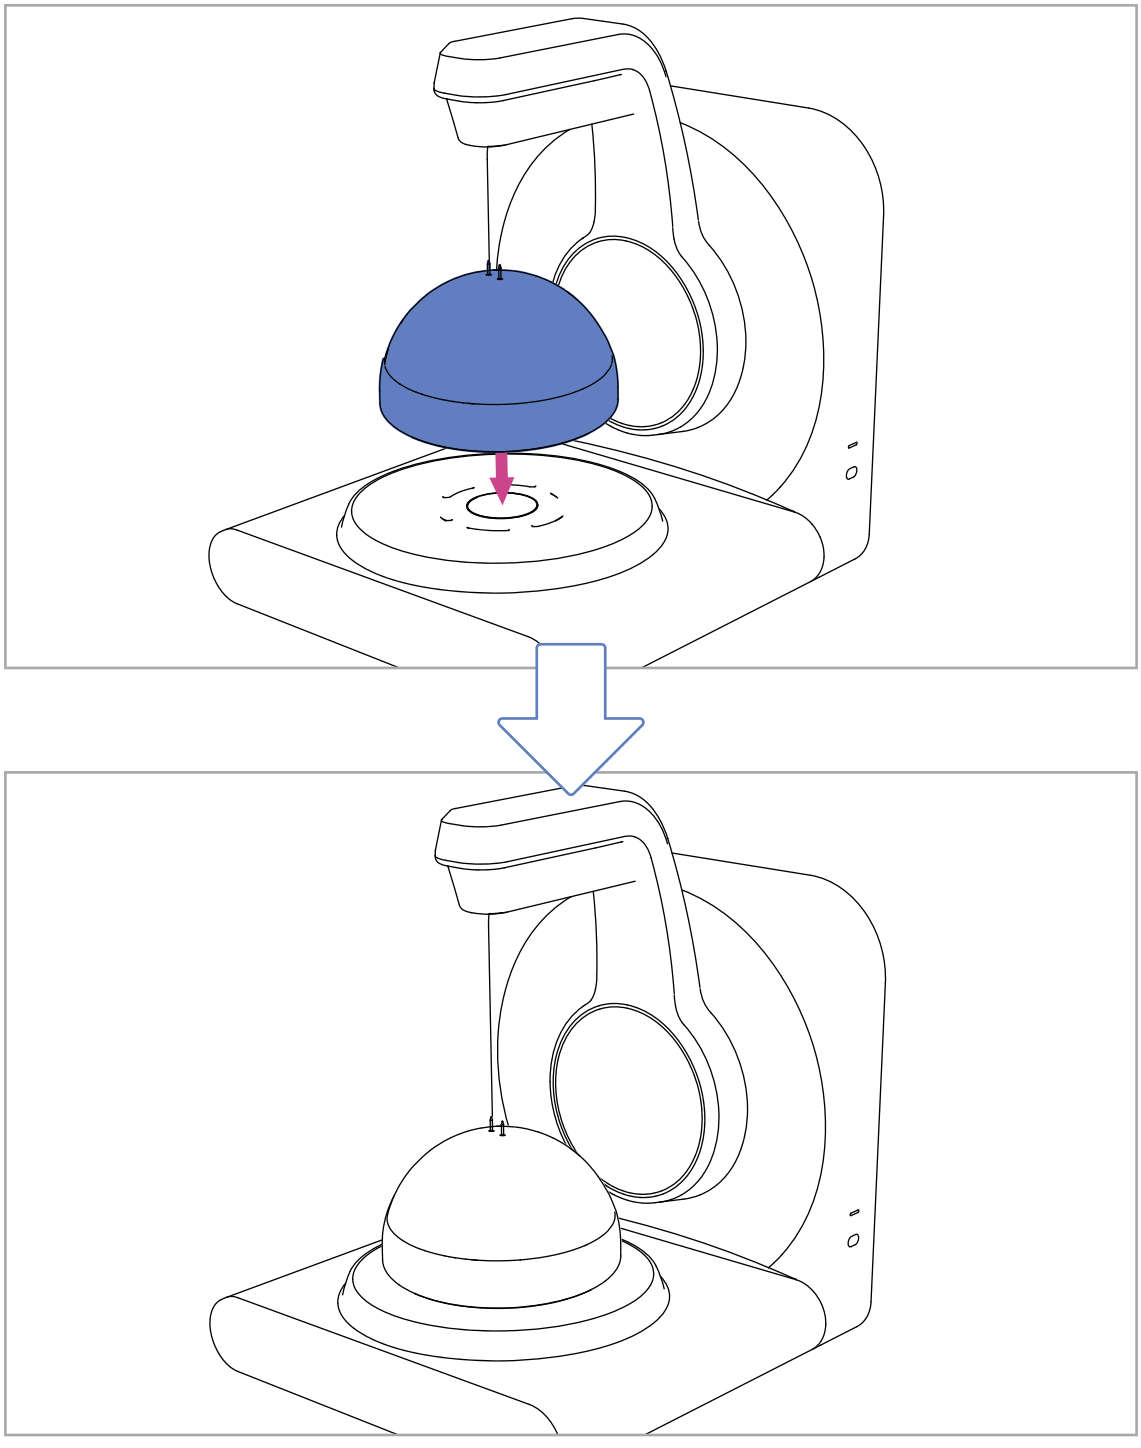

① Place the spherical stage or pedestal on the scanner body.
(Taking the operation of the spherical stage as an example.)


P2

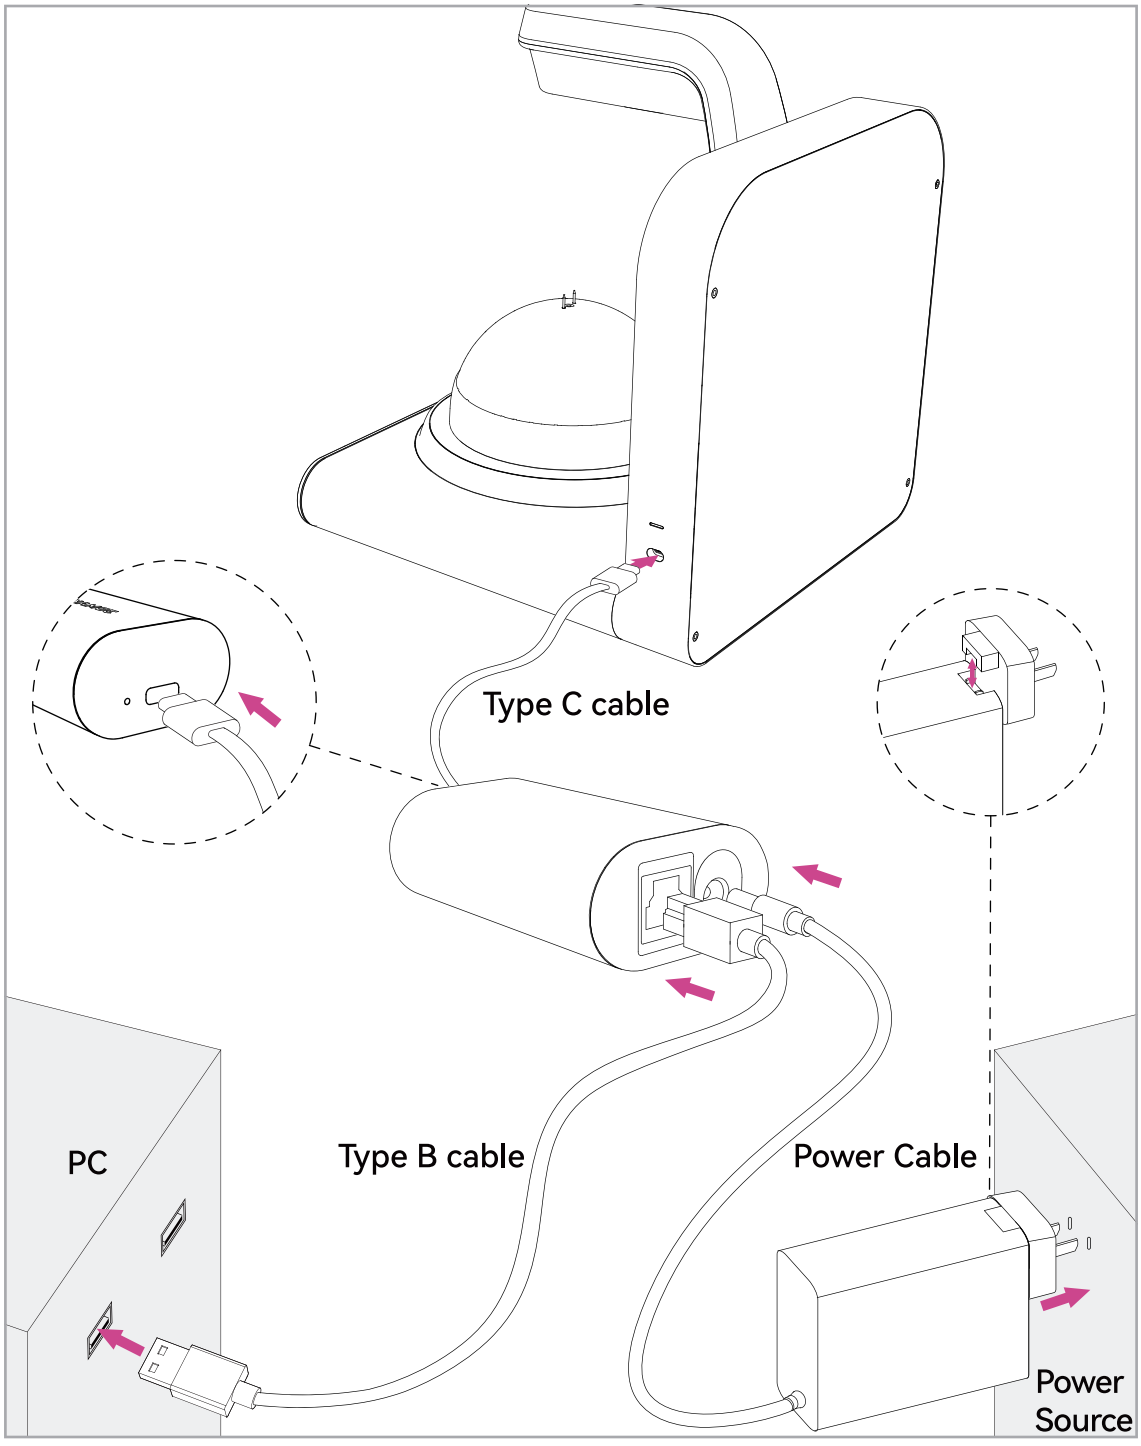


② Please connect all the cables as shown in the illustration.

* The use of power plugs and sockets shall be based on actual usage.


P3 PACKING LIST

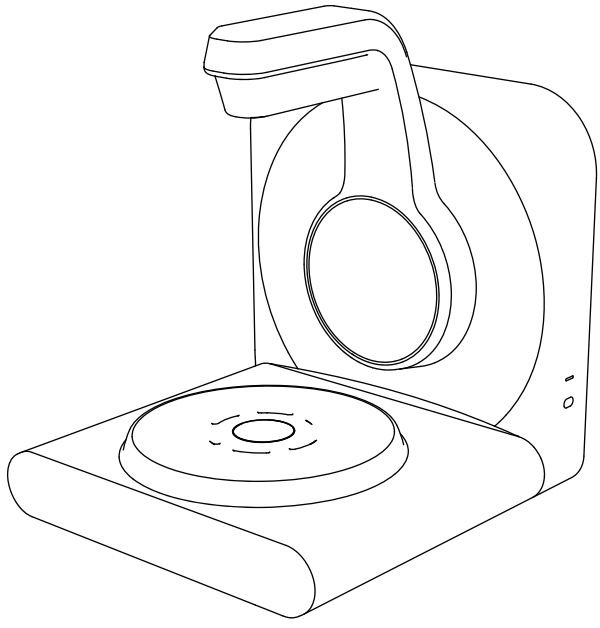


Scanner Body

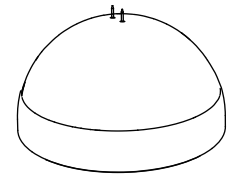


Spherical stage

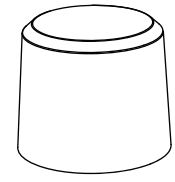


Pedestal

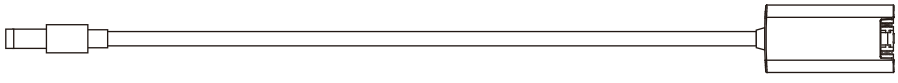


Power Cable

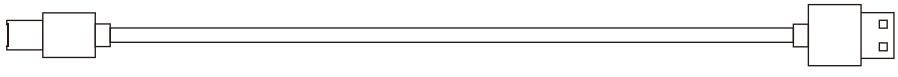


Type B cable




Type C cable

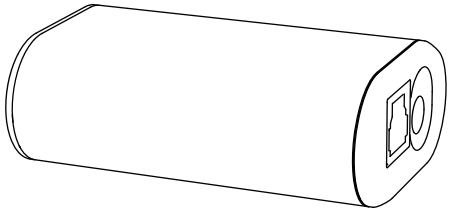

Distribution Box

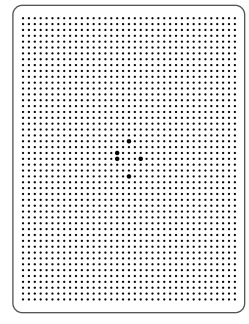

Calibration Board

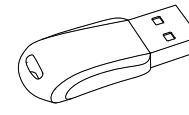

USB Flash Drive

*The appearance of the product isn't standard across all specifications and editions. Product images are for illustrative purposes only!